

Technical Data Sheet Specification U330A4V138Z2 (**365nm**) RoHS

HONGLIZHIHUI BYTECH

BYTECH

鸿利智汇

Bytech Electronics CO., Ltd is the first company in China to launch the real inorganic package UV LED devices and core components for application based on CMH technology.

CMH technology platform is a kind of package technology which adopts ceramic, metal, hard glass as package materials. CMH technology platform originates independent intellectual property owned by Bytech Electronics CO., LTD, which is suitable for vacuum encapsulation, especially suitable for ensuring reliability of deep UV products.



By technology, for people.





Under Development
Mass Production

U330A4V138Z2

All a

ATTENTION OBSERVE PRECAUTIONS FOR HANDLING ELECTROSTATIC DISCHARGE SENSITIVE DEVICES

Features

- Resin package
- Dimension 3.0mmx3.0mmx0.6mm
- Long operating life
- High reliability
- Superior ESD protection

-3,00-

RoHS compliant


Applications

- Mosquito lamp
- UVLED light bulbs
- UV flashlight
- UV glue curing lamp
- The scorpion lamp
- Other UV lamps


Package Dimensions (Unit: mm)

Product ID:



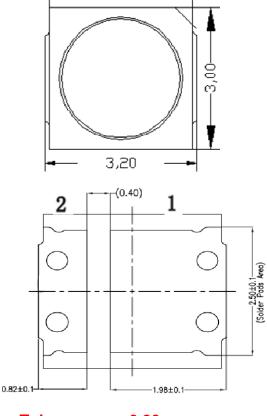



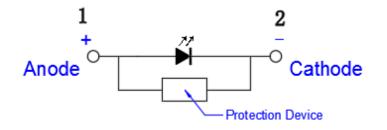

Tolerance : ± 0.20mm



UV LED

Under Development	
Mass Production	•

U330A4V138Z2

Characteristics of UV LED

1. Electrical / Optical Characteristics (Ta=25°C,**RH=40%**)

Parameter	Symbol	Units	U330A4V138Z2 (IF=80mA)
Peak Wavelength [1]	λ _p	nm	360-370
Radiant Flux [2]	Φ _e [3]	mW	60-90
Forward Voltage [4]	VF	V	3.4-4.0
Spectrum Half Width	Δλ	nm	10
View Angle	20 _{1/2}	deg	120

Notes:

[1].Peak wavelength measurement tolerance:±3nm

[2].Radiant flux measurement tolerance:±10%

[3]. $\Phi_{\rm e}$ is the total radiant Flux as measured with an integrated sphere

[4].Forward voltage measurement tolerance:±3%


2. Absolute Maximum Ratings (T_a=25°C,RH=40%)

Parameter	Symbol	Units	U330A4V138Z2	
Maximum Rating Forward Current	I _{Fmax}	mA	100	
Maximum Rating Junction Temperature	T _{jmax}	°C	110	
Operating Temperature Range T _{op}		°C	C -30 ~ +80	
Storage Temperature Range	T _{stg}	°C	-40 ~ +120	

Notes:

Operating the LED beyond the listed maximum ratings may affect device reliability and cause permanent damage. These or any other conditions beyond those indicated under recommended operating conditions are not implied. The exposure to the absolute maximum rated conditions may affect device reliability.







U330A4V138Z2

Characteristics Diagrams


1.Relative Spectrum Power Distribution

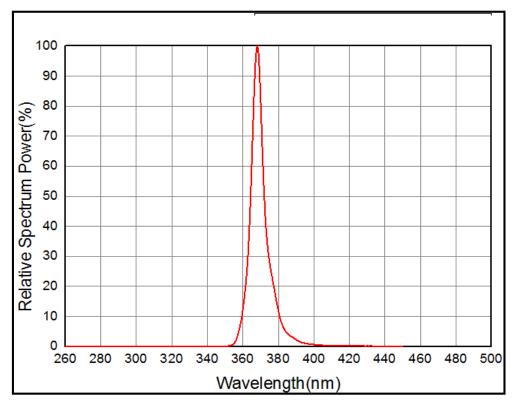


2.Forward Voltage vs Forward Current

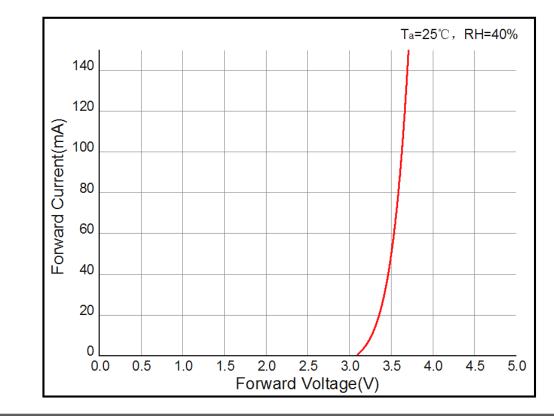







U330A4V138Z2

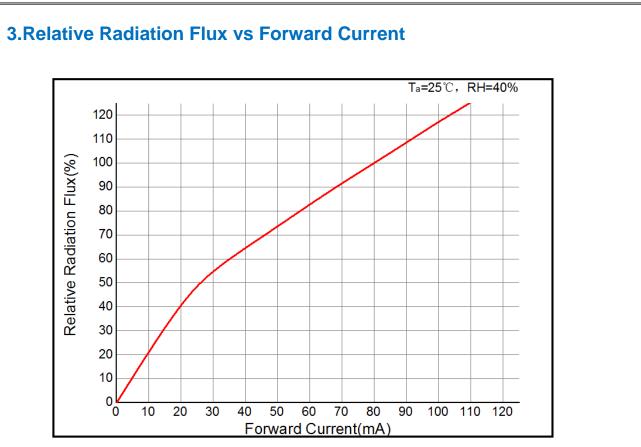

4. Peak Wavelength vs Forward Current

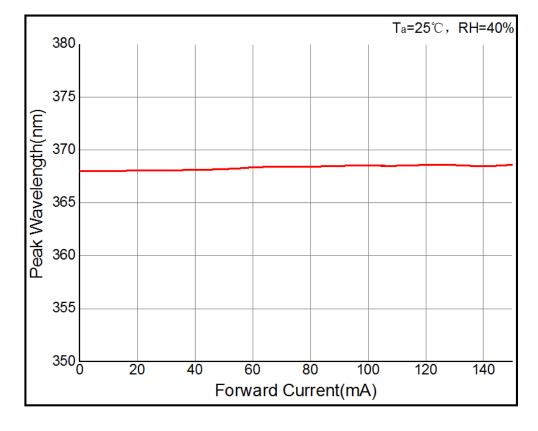







U330A4V138Z2



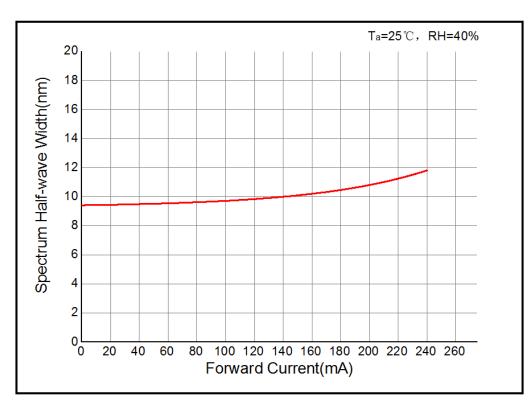

6.Spatial Distribution Graph

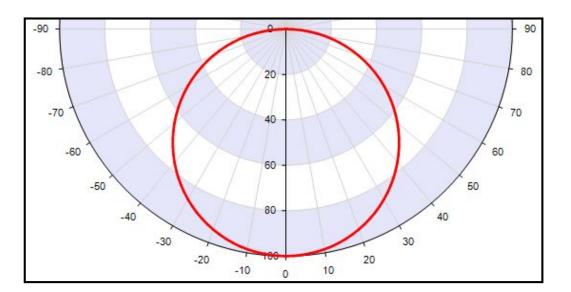





U330A4V138Z2

Under Development	
Mass Production	•

Product Application Information

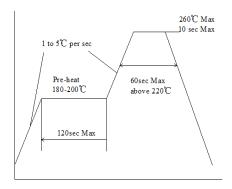

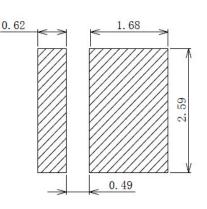

Recommended Reflow Soldering Condition (Lead-free solder)



Notes:

*This LED is designed to be reflow soldered on to a PCB.If dip soldered or hand soldered,

Bytech cannot guarantee its reliability.

*Reflow soldering must not be performed more than twice.

*Avoid rapid cooling. Ramp down the temperature gradually from the peak temperature.

*Nitrogen reflow soldering is recommended.Air flow soldering conditions can cause optical degradation,

caused by heat and/or atmosphere.

*Since the silicone used in the encapsulating resin is soft, do not press on the encapsulant resin.

pressure can cause nicks, chip-outs, encapsulant delamination and deformation, and wire breaks, decreasing reliability .

*Repairing should not be done after the LEDs have been soldered.When repairing is unavoidable,a double-head soldering iron should be used.

It should be confirmed beforehand whether the characteristics of the LEDs will or will not be damaged by repairing.

*The Die Heat Sink should be soldered to customer PCB.

If it is difficult or impossible, use high heat-dissipating adhesive.


*When soldering, do not apply stress to the LED while the LED is hot.

*When using a pick and place machine, choose an appropriate nozzle for this product.


*When flux is used, it should be a halogen free flux. Ensure that the manufacturing process is not designed in a manner Where the flux will come in contact with the LEDs.

*Make sure that there are no issues with the type and amount of solder that is being used.





U330A4V138Z2

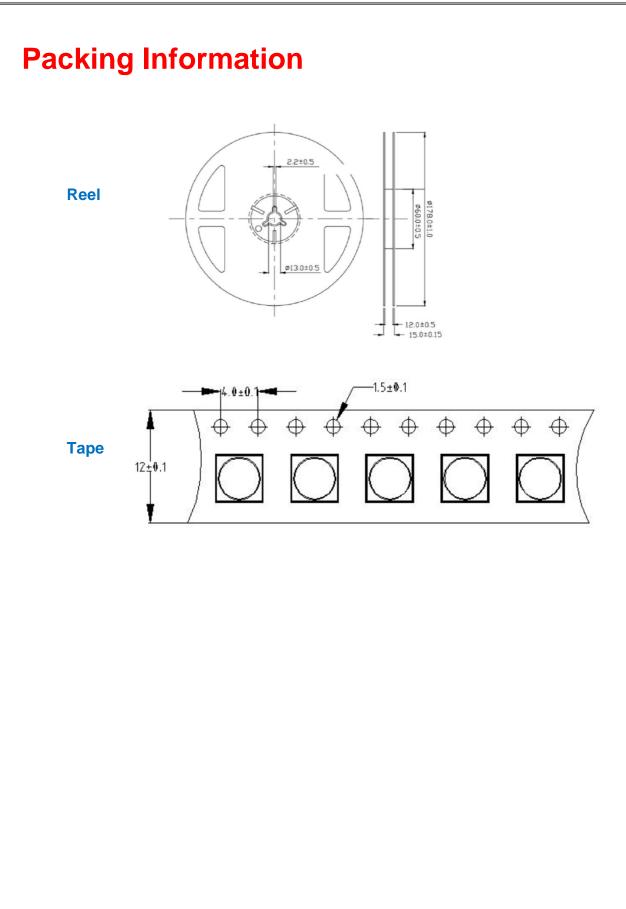





U330A4V138Z2

CAUTIONS

1. Handling Precautions

• Do not handle the LEDs with bare hands as it will contaminate the LEDs surface and may affect the optical characteristics.

• When handling the product with tweezers, be careful not to apply excessive force to the resin.Otherwise,The resin can be cut,chipped,delaminate or deformed,causing wire-bond breaks and catastrophic failures.

Dropping the product may cause damage.

2. Electrostatic Discharge (ESD)

• The product are sensitive to static electricity or surge voltage. ESD can damage a die and its reliability. When handling the products, the following measure against electrostatic discharge are strongly recommended:

Eliminating wrist strap, ESD footwear, clothes, and floors

Grounded workstation equipment and tools

ESD table/shelf mat made of conductive materials

• Ensure that tools, jigs and machines that are being used are properly grounded and that proper grounding techniques are used in work areas. For devices/equipment that mount the LEDs, protection against surge voltages should also be used.

• The customer is advised to check if the LEDs are damage by ESD

When performing the characteristics inspection of the LEDs in the application.

Damage can be detected with a forward voltage measurement at low current(\leq 1mA).

3. Eye Safety


• Please proceed with caution when handling any UVLEDs driven at low or high current.

Since UV light can be harmful to eyes, do Not look directly into the UV light, even through an optical instrument.

• UV protective glasses are required to use in order to avoid damage by UV light in case of viewing UV light directly.







U330A4V138Z2

History of Revision

Revision	Date	Contents of Revision Change	Remark
REV NO: 1.0	2017.09.27	New Establishment	